

MODEL	X22S
Ø OUTPUT SHAFT	20 mm
APPROXIMATE RATIO	13
EXACT RATIO	13.07
OUTPUT SPEED	112 RPM
EXACT OUTPUT SPEED	112 RPM
INPUT POWER	0.09 KW
INPUT ROTATION	1400 RPM
INPUT PAM	56B14
OUTPUT TORQUE	7.70 N.m
NOMINAL TORQUE	45.00 N.m
NOMINAL POWER	0.53 KW
SERVICE FACTOR	5.89
DYNAMIC EFFICIENCY	0.96

Oil Quantity (L)

B3/H1	B6/H4	B7/H3	B8/H2	V5/H5	V6/H6
0.25	0.25	0.25	0.25	0.43	0.31

Radial and Axial Loads





n_2 [min-1]	F_A [N]	F_R [N]
400	360	1800
150	420	2100
75	440	2200
25	440	2200


P X22SC...	Basic Gearbox Riduttore base
-------------------	---------------------------------

Gearbox weight peso riduttore	3.70 kg
---	----------------


M. flanges	Kit code	$\varnothing F$	A
63B5	K050.4.041	138	154.5
71B5	K050.4.042	160	152
56B14	KC40.4.049	80	152
63B14	K050.4.047	90	154.5
71B14	K050.4.045	105	152

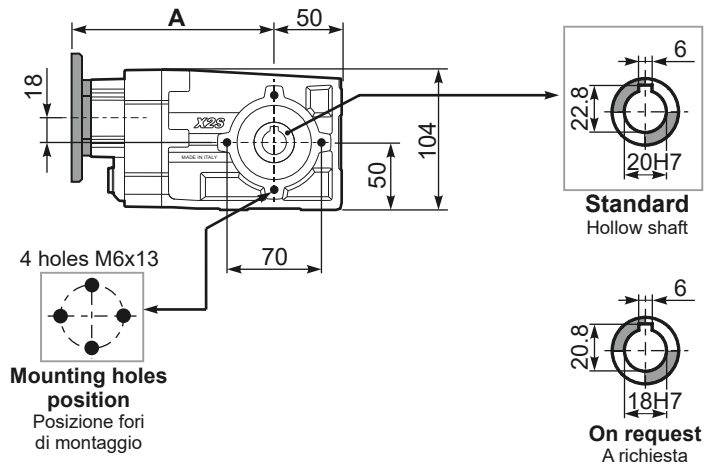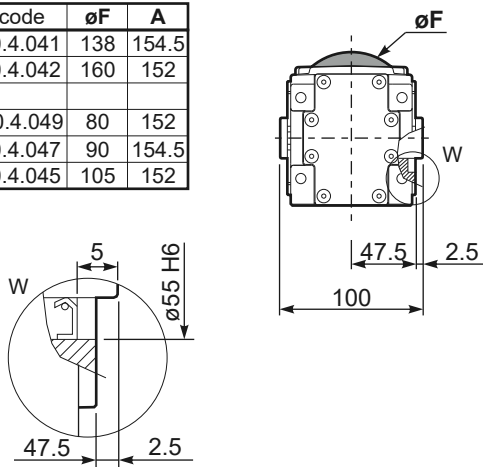


PX22S...**FB**.. Feet
Piedini

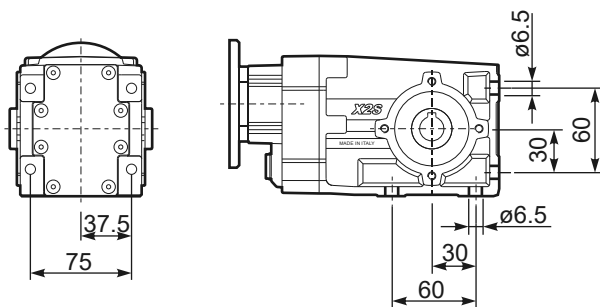


PX22S...-F1.. Output flange
Flangia uscita

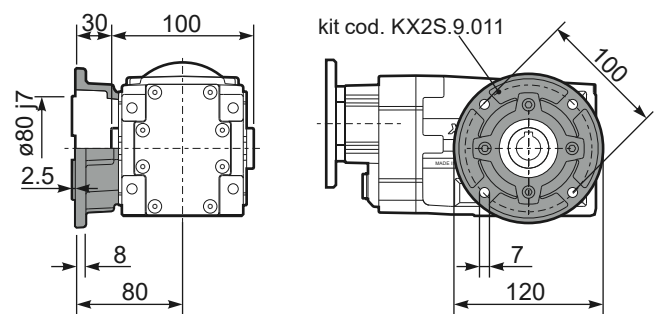

PX22SA.. Single output shaft
Albero semplice in uscita

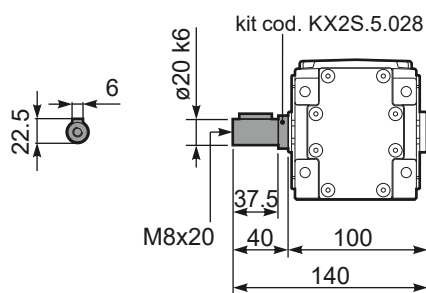

PX22S... BR ..	Reaction Arm Braccio di reazione
-----------------------	-------------------------------------

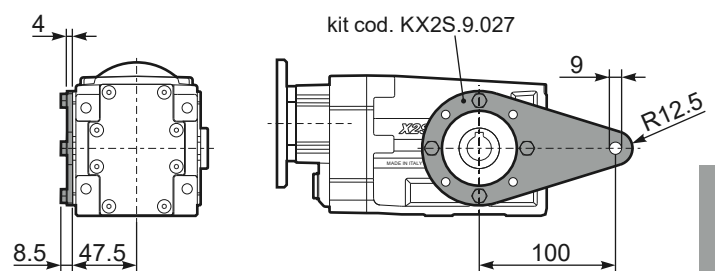

R X22S..	Input shaft Albero in entrata
-----------------	----------------------------------

